SKETCH OF
WOODS BROTHERS STANDARD STEEL CURRENT RETARD.

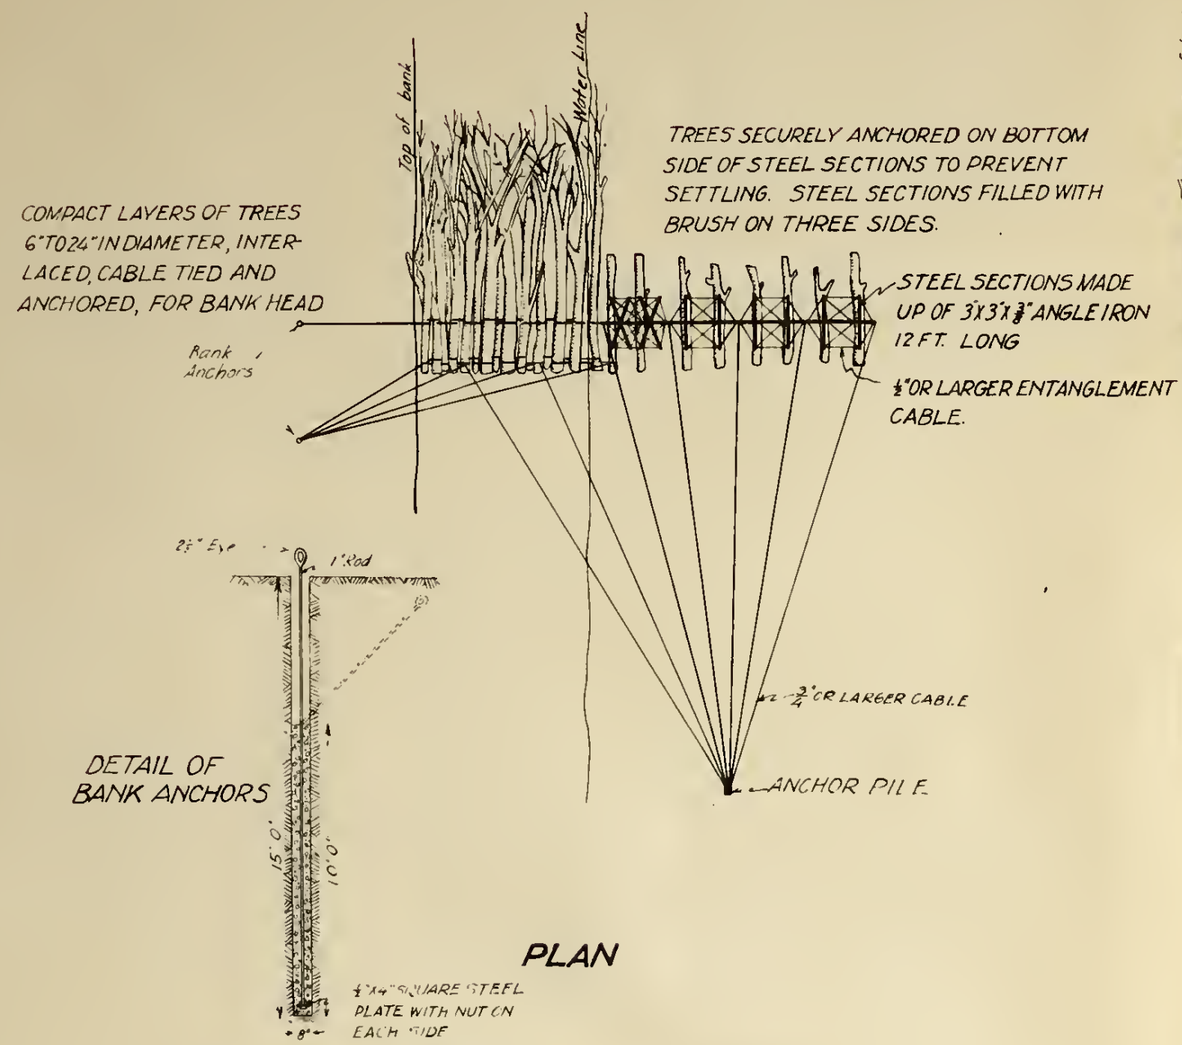
Top of bank
Water Line
COMPACT LAYERS OF TREES 6" TO 24" IN DIAMETER, INTERLACED, CABLE TIED AND ANCHORED, FOR BANK HEAD
Bank Anchors
TREES SECURELY ANCHORED ON BOTTOM SIDE OF STEEL SECTIONS TO PREVENT SETTLING. STEEL SECTIONS FILLED WITH BRUSH ON THREE SIDES.
STEEL SECTIONS MADE UP OF 3"X3"X⅜" ANGLE IRON 12 FT. LONG
½" OR LARGER ENTANGLEMENT CABLE.
¾" OR LARGER CABLE
ANCHOR PILE

DETAIL OF BANK ANCHORS

PLAN

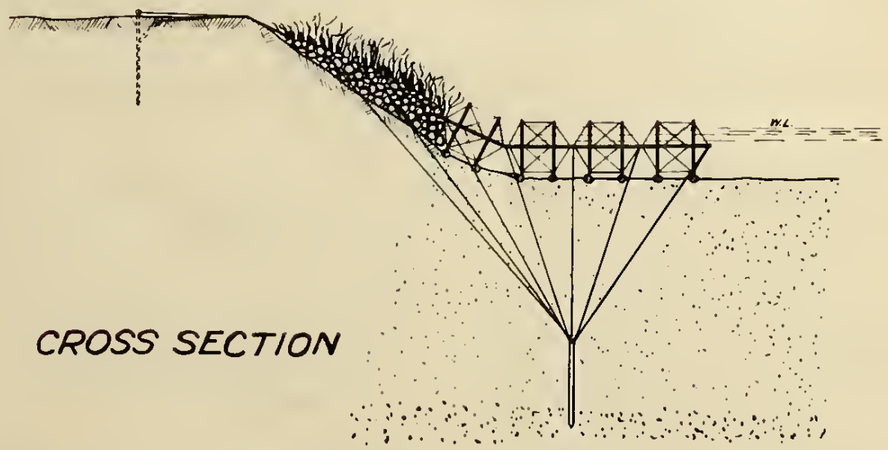

CROSS SECTION

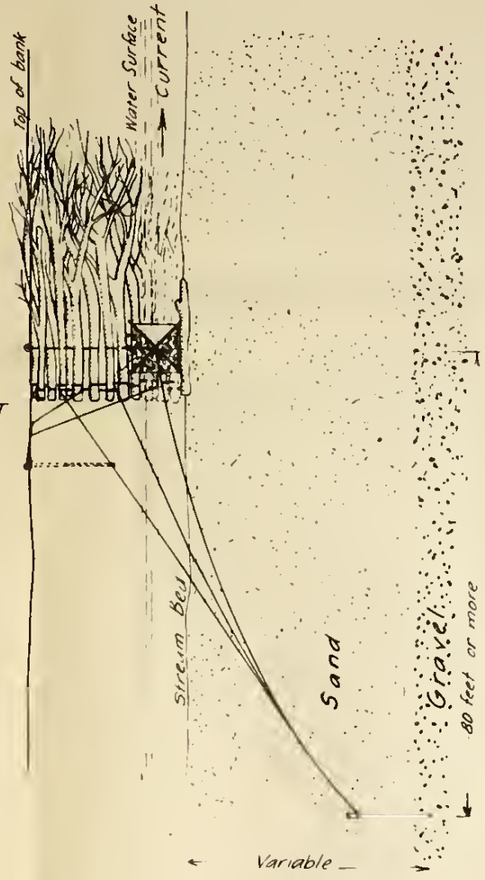

LONGITUDINAL SECTION

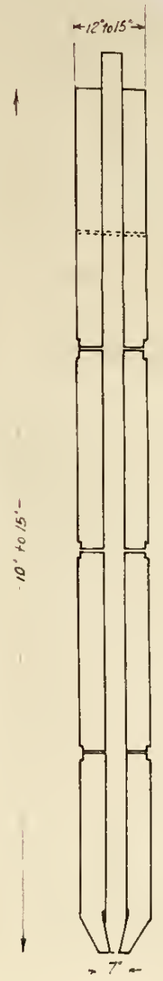

ANCHOR PILE

Exhibit "C"

REC. DIST. Nº2064	
CURRENT RETARDS	
DEC. 1925.	
Harmon S. Bonte, Engr.	L-35.

Digitized by the Internet Archive
in 2013

http://archive.org/details/recdistno2064cur00harm_3

1966.x237.001